




**Integrated Control Technology**

# **Protege GX Controller Firmware**

Release Notes | Version 2.08.1255

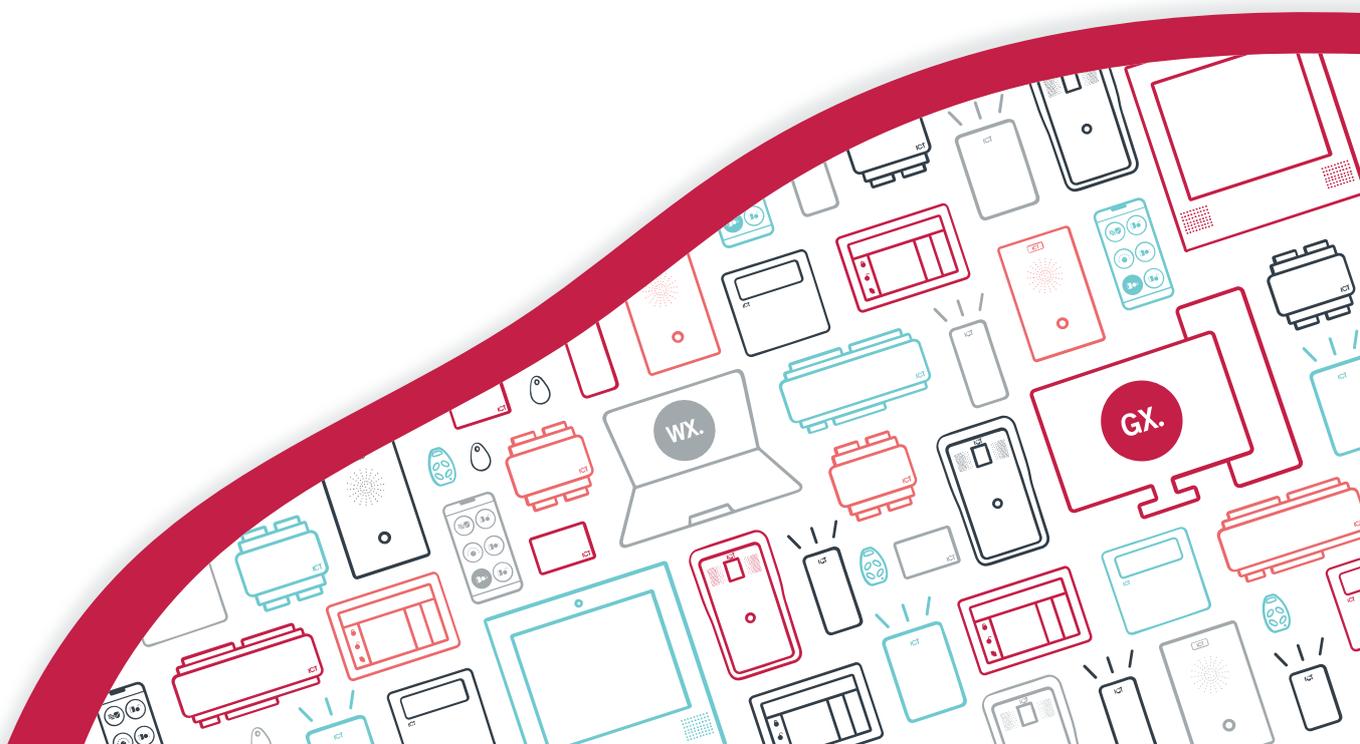

The specifications and descriptions of products and services contained in this document were correct at the time of printing. Integrated Control Technology Limited reserves the right to change specifications or withdraw products without notice. No part of this document may be reproduced, photocopied, or transmitted in any form or by any means (electronic or mechanical), for any purpose, without the express written permission of Integrated Control Technology Limited. Designed and manufactured by Integrated Control Technology Limited, Protege® and the Protege® Logo are registered trademarks of Integrated Control Technology Limited. All other brand or product names are trademarks or registered trademarks of their respective holders.

Copyright © Integrated Control Technology Limited 2003-2022. All rights reserved.

Last Published: 28-Mar-22 10:45 AM

# Contents

<b>Introduction</b>	<b>5</b>
Supported Hardware	5
Older Controller Limitation	5
<b>Updating Firmware</b>	<b>6</b>
Updating Firmware from the Protege GX User Interface	6
Updating to Versions above 2.08.1068	6
<b>Protege GX Controller Firmware 2.08.1255</b>	<b>7</b>
New Features (2.08.1255)	7
Feature Enhancements (2.08.1255)	7
Issues Resolved (2.08.1255)	7
Known Issues (2.08.1255)	8
<b>Previous Release History</b>	<b>9</b>
Protege GX Controller Firmware 2.08.1244	9
New Features (2.08.1244)	9
Feature Enhancements (2.08.1244)	9
Issues Resolved (2.08.1244)	10
Protege GX Controller Firmware Version 2.08.1140	12
New Features (2.08.1140)	12
Feature Enhancements (2.08.1140)	13
Issues Resolved (2.08.1140)	14
Protege GX Controller Firmware Version 2.08.1002	16
New Features (2.08.1002)	16
Feature Enhancements (2.08.1002)	17
Issues Resolved (2.08.1002)	17
Protege GX Controller Firmware Version 2.08.911	18
New Features (2.08.911)	18
Feature Enhancements (2.08.911)	20
Issues Resolved (2.08.911)	21
Protege GX Controller Firmware Version 2.08.0848	22
New Features (2.08.0848)	22
Issues Resolved (2.08.0848)	22
Protege GX Controller Firmware Version 2.08.0843	23
New Features 2.08.0843	23
Feature Enhancements 2.08.0843	23
Issues Resolved 2.08.0843	23

Protege GX Controller Firmware Version 2.08.0825 .....	24
New Features (2.08.0825) .....	24
Feature Enhancements (2.08.0825) .....	25
Issues Resolved (2.08.0825) .....	25

# Introduction

---

This document provides information on the new features, enhancements and resolved issues released with:

- Protege GX controller firmware version 2.08.1255

A full release history for previous versions is also included.

## Supported Hardware

This firmware is supported in the following Protege GX controller modules:

Product Code	Controller Module
PRT-CTRL-DIN	Protege GX DIN Rail Integrated System Controller
PRT-CTRL-DIN-IP	Protege GX DIN Rail Integrated System Controller (IP only)
PRT-CTRL-DIN-3G	Protege GX DIN Rail Integrated System Controller with 3G
PRT-CTRL-DIN-ID	Protege GX DIN Rail Single Door Controller
PRT-CTRL-DIN-ID-POE	Protege GX DIN Rail Single Door Controller with PoE

## Older Controller Limitation

Due to physical technology limitations, older controller hardware is currently not capable of loading the latest firmware versions.

Controller models without physical USB ports may not support newer firmware files. If your controller does not have a USB port, **do not** attempt to upgrade it to the current version without confirming compatibility.

In particular, controllers manufactured prior to **December 2015** use an older operating system which is not compatible with firmware versions higher than **2.08.1002**. There are two methods for checking your controller's manufacture date:

- The warranty sticker on the back of the controller shows the month and year of manufacture.
- Contact ICT support with a list of controller serial numbers to check.

It may be possible to upgrade the operating system of the controller and allow use of the latest firmware versions. Contact ICT support for more information.

# Updating Firmware

---

Updating controller firmware can be carried out from the Protege GX user interface. It is also possible to update the firmware of individual controllers from the **Application Software** section of the controller web interface.

PCB and DIN controllers run completely different firmware. **Deploying incorrect firmware to a controller will result in total failure.** This can be corrected, however the process to do so is time consuming. Please ensure you download and install the correct firmware for your device.

## Updating Firmware from the Protege GX User Interface

1. Open and log in to the Protege GX application and ensure that you have a connection to the controller that you wish to update.
2. From the main menu, select **Sites | Controllers**.
3. Right click on a controller and select **Update Firmware**.
4. Click the **[...]** button and browse to the supplied firmware (.bin) file.
5. Choose which controller(s) to update by selecting the **Include** option. Only the selected controller(s) will be updated.
6. Click **Update** to commence the firmware update procedure.  
The update can take up to 10 minutes per controller to complete. Once complete, the controller is automatically restarted.
7. On completion of a firmware update a download is required to update controller programming. Right click on the controller record and select **Force Download**.

## Updating to Versions above 2.08.1068

In controller firmware version 2.08.1068 and above, the controller cannot have an admin operator with the default login credentials (**Username:** admin and **Password:** admin). If these default credentials have not been changed and you update the firmware to this version, you will be prompted to create a new admin operator the next time the web interface is accessed. This new operator will be granted the same permissions as the previous admin operator.

This is not required if the default admin password has been changed.

# Protege GX Controller Firmware 2.08.1255

---

## New Features (2.08.1255)

The following new features have been included with this release.

### USB Cellular Modem Support

This firmware version includes support for the new Protege DIN Rail Cellular Modem. This 4G modem connects to the controller via the USB port and provides an alternative communication pathway between the controller and central monitoring station or Protege GX server.

- The 4G modem is designed for reporting of events and alarms to the central monitoring station. This is ideal for replacing existing phone lines for backup reporting services.
- The controller is also capable of connecting to the Protege GX server over the 4G cellular network for sending events and receiving downloads and manual commands. This enables you to extend the reach of your Protege GX system to areas without physical network infrastructure.

This feature requires a SIM card that supports inbound data connections.

- Additional tabs have been added to the **System Settings** in the controller's web interface, allowing you to configure the onboard ethernet and 4G modem (USB ethernet) connections separately and define which adaptor will be used by each event server path.

For more information on the Protege DIN Rail Cellular Modem and configuring it for use with Protege GX, see the relevant product documentation.

## Feature Enhancements (2.08.1255)

The following enhancements have been made to existing features in this release.

### EOL Resistor Programming

- Added support for 3 Resistor EOL input doubling with 6 states.

The feature can be used on any input and is set up using the physical input and another input record which is offset by the total physical inputs of the device. The 6 states are then translated to input states for both.

For more information and programming instructions, see Application Note 303: Configuring Protege Input EOL Resistors Using Commands.

## Issues Resolved (2.08.1255)

The following issues were resolved with this release.

- Resolved an issue where the **Bell squawk only when unattended** feature did not work as expected. Now, arming and disarming by card reader or function code will not cause a squawk when this feature is active.
- Resolved an issue where latch unlocking a door group would not unlock any doors that were momentarily unlocked by access.
- Resolved an issue where the PRT-ZX1 firmware could not be upgraded from the controller web UI.

## Known Issues (2.08.1255)

ICT would like to make you aware of the following known issues in this version:

- When the **Entry/Exit reading mode** is set to Custom and the card and biometric credential types are selected, the door does not correctly accept the biometric credentials and denies access.
- When door's lock time is recycled by a user with **User operates extended door access function** enabled, the door's standard lock time is used instead of the extended lock time.

# Previous Release History

---

## Protege GX Controller Firmware 2.08.1244

### New Features (2.08.1244)

The following new features have been included with this release.

#### Function Outputs

Function outputs provide an alternative method of controlling outputs based on the door state. When the door is unlocked, up to three function outputs or output groups can be activated. These operate independently of the lock outputs, allowing you to control connected devices such as automatic door pumps, chair lifts and bypass shunts.

- Program up to three separate function outputs or output groups for each door, each with a different activation time.
- Activate the function output every time the door is unlocked, or only when the door is unlocked by access or REX/REN. Activation can also be restricted to people with disabilities for control of accessibility devices.
- Outputs can be deactivated when the door is opened or closed.
- Outputs can be recycled by user access or REX/REN, allowing users to keep the output activated for longer.

This feature requires Protege GX software version 4.3.317.10 or higher. For more information and programming instructions, see [Application Note 336: Programming Function Outputs in Protege GX](#).

### Feature Enhancements (2.08.1244)

The following enhancements have been made to existing features in this release.

#### Disable Remote Area Arming, Disarming and 24hr Disarming

- Added the ability to disable remote arming and disarming of an area.  
This is achieved by adding the appropriate command(s) to the programming of each required area.
  - Add the command **NoRemoteArm = 1** to disable remote arming.
  - Add the command **NoRemoteDisarm = 1** to disable remote disarming.
  - Add the command **No24hrRemoteDisarm = 1** to disable remote 24hr disarming.

This feature supports ULC Standard S302 which limits arming and disarming of a Security Level 3 or Level 4 Area to only the local system keypad(s).

These protection requirements are applicable for safes, ATMs, CDUs, CRUs, night depositories and vaults.

For information on how to configure this feature, see [Application Note 326: Disabling Remote Area Arming and Disarming](#).

#### Area Counting Options

- A new **Area Count on Door Opening** option has been added. When this option is enabled the area count is not incremented/decremented by the user merely being granted access, but will be updated only if the door has been opened after entry/exit is granted.

To enable the option, add to the area programming the command: **AreaCountOnDoorOpening = true**

For more information see [Application Note 205: Area Counting](#).

#### Controller Password Policy

- This version includes the initial implementation of a password policy for controller operators. All new operator passwords are now required to have 8 characters or more. Existing passwords are not affected.

Further functionality is in development.

### Cybersecurity Enhancements

- Removed insecure FTP and Telnet protocols from the controller.
- Removed an insecure debug mechanism.

### Otis Compass HLI Integration

- Increased the number of floors supported by the Otis HLI integration from 64 to 128. This can be implemented by entering the following commands in the controller programming:
  - `HLI_128_FLOORS = true`
  - `HLI_MAX_FLOORS = 128`

### Language Support

- Updated translations on the controller web interface.
- Added Turkish as a selectable language on the controller.

## Issues Resolved (2.08.1244)

The following issues were resolved with this release.

- Resolved an issue where multiplexed Wiegand readers were not able to read custom credentials.
- Resolved an issue where badging custom credentials multiple times at multiplexed Wiegand readers could cause a controller crash.
- Resolved an issue where areas could not be armed using card read and input 8 of a reader expander using RS-485 readers.
- Resolved an issue with the ASSA ABLOY DSR integration where door status was not being displayed correctly.
- Resolved an issue with the ASSA ABLOY DSR integration where PIN and credential expiry did not work.
- Resolved an issue with the ASSA ABLOY DSR integration which could cause a controller crash if no smart reader records were assigned to the DSR locks.
- Corrected an issue in the ASSA ABLOY DSR integration where an unexpected response from the DSR could cause the controller to crash.
- Resolved an issue where the **Always log input event** option was not enabled/disabled correctly when the input type was changed by an operating schedule.
- Resolved an issue which was causing persistent memory leak in 3G-enabled controllers. This could prevent operators from accessing the controller's web interface, with the following error message: 'The Web Server is too busy, cannot handle any more connections.'
- Resolved an issue where the HTTP port for the controller's web interface could be set to 0 or other restricted ports. Added an error messages to notify operators when the selected port is not valid.
- Corrected an issue where, when HTTPS was enabled, an HTTP connection could still be established on one randomly chosen port.
- Resolved an issue where the LEDs of OSDP readers connected to a reader expander did not function correctly if the controller's onboard reader was not also configured for OSDP.
- Removed a vulnerability where programming information was visible on legacy controller web pages.
- Resolved an issue where single door controllers did not detect the defaulting link on power up.
- Resolved an issue where deleting a programmed elevator record could cause the controller to restart on a card badge.
- Resolved an issue in the Otis MLI integration where the controller was not sending 'Set Access' packets to the elevator controller.
- Resolved an issue with the Otis MLI integration where the last elevator car on each interface was displaying 'Floor Unknown' for all floors.

- Resolved an issue in the Otis MLI integration where, when a user gained access to a floor, the event log would report the incorrect floor number.  
To implement this fix, enter the command **AEAFloorOffset=X** in the controller programming. **X** is a value from -8 to 8 that will be added to the floor relay values for the purpose of event reporting.
- Resolved an issue where controller operators could not be deleted.
- Resolved an issue where 'Access denied by door type' events were not displayed correctly when access was denied due to an incorrect credential type.
- Resolved an issue where the controller could not process osdp\_RAW packets received from Idesco readers.
- Resolved an issue where, if a user had two credentials with the same facility/card number but different credential types, the last used time would be updated for both credentials whenever one credential was used.
- Fixed an issue where it was not possible to search for operators that contained an ampersand and/or equals sign in the record name.
- Resolved an issue where PINs entered at a 4 bit HID PIN pad could fail if entered immediately after a card read at another reader (using multiplexed Wiegand readers on the onboard reader expander).
- Fixed an issue where areas could be incorrectly disarmed by schedules that crossed over midnight.
- Improved the controller firmware update process. This mitigates an issue where the software incorrectly reports that the firmware update has been interrupted.
- Added the ability to introduce a regular time correction to the controller's internal clock. This mitigates an issue where controllers running in offline mode for long periods can experience time drift.

To implement this fix, add the following command in the controller programming:

**TimeDriftComp = X, Y**

Where **X** is the frequency for applying the time correction (in days), and **Y** is the amount of the time correction (in seconds). For example, the command **TimeDriftComp = 2, 10** will add 10 seconds to the controller's clock every 2 days.

- Resolved an issue with card readers configured for card and PIN authentication where the card could be entered at the entry reader and the PIN at the exit reader, and vice versa.
- Resolved an issue where unaddressed modules were not displayed in the module addressing window after the controller restarted.
- Resolved an issue where function codes could not be used on smart readers.
- Resolved an issue that was exacerbating clock drift.
- Resolved an issue where the **Disable green LED processing** option in the reader expander programming did not work for readers connected in RS-485 configuration.

**Limitation:** This feature is not available for smart readers.

- Resolved an issue with the KONE Destination 880 integration where commands programmed for Group 1 and Group 2 would be overridden by UI programming if it was present.
- Resolved an issue with the KONE Destination 880 integration where "RCGIF" as part of a command was interpreted as an entire command and resulted in the service stopping.
- Resolved an issue where turnstiles were not correctly calling an elevator for the home floor.
- Modified the KONE Destination 880 integration to accommodate some KONE group controllers that do not follow the recommended heartbeat protocol.
- Resolved an issue where the controller's **Settings** page was not displayed correctly when non-English characters were used in some record names.
- Resolved an issue where areas would not arm correctly on schedule when successive days ending in midnight in the same period were checked.
- Resolved an issue where it was not possible to enter a hostname in the event server address fields.
- Resolved an issue where access was denied incorrectly for doors with the Card and PIN door type while locked by calendar action.
- Resolved an issue where the time displayed in the web interface would drift backwards when the browser tab was not focused, so that it did not accurately display the controller time.

- Resolved an issue where multiplexed Wiegand readers connected to a reader expander would not produce 'Exit Granted' events for custom credential types.
- Resolved an issue with the ASSA ABLOY DSR integration where the controller could restart during initial synchronization.
- Resolved an issue where it was not possible to access the keypad using the default installer code after defaulting the controller.
- Verex Transition:
  - Resolved an issue where the controller did not process all four inputs on legacy Verex keypads correctly.
  - Resolved an issue where the arm function display did not line up with the correct function key.

## Protege GX Controller Firmware Version 2.08.1140

### New Features (2.08.1140)

The following new features have been included with this release.

#### Controller Default Security Upgrades

This release includes significant changes to the process of setting a password and defaulting the controller. These changes ensure that Protege GX is compliant with Title 1.81.26: Security of Connected Devices, enacted by the State of California.

Upon firmware upgrade, you will be asked to change your password if it is still the default. Defaulting a controller now resets all settings to the factory default, including IP and login information. In the future, new controllers shipped from the factory will have HTTPS enabled by default and require you to set a custom login username and password.

In the past, when a controller was defaulted, only the programming database was deleted. With this version, the controller is entirely reset to factory default, with the following effects:

- The IP address is reset to the default address (192.168.1.2).
- Any custom HTTPS certificate uploaded by an operator is deleted and must be reloaded.
- All other **System Settings** (e.g. HTTP Port, DNS Server, Event Servers) revert to their default values.
- All programming is deleted, including all operators.

When you access the web interface after defaulting the controller, you will be required to create a new username and password for the administrator operator.

#### Protege GX ASSA ABLOY DSR Integration

This release introduces the Protege GX ASSA ABLOY DSR integration. The integration provides the ability for Protege GX to connect and communicate with IP-enabled ASSA ABLOY locks, via the ASSA ABLOY DSR (Door Service Router) system.

In this integration, a single Protege GX controller communicates with the ASSA ABLOY DSR server, which in turn communicates with up to 1024 IP-enabled locks over WiFi or ethernet. Protege GX controls and maintains all access control functions and receives alarms and events from the DSR server.

For integration details and configuration information, refer to AN-311: Protege GX ASSA ABLOY DSR Integration.

#### User Interface Improvements

This version features improvements to the controller's user interface.

- Switch between light and dark display themes to reduce eye strain.
- Pick the display color used for the header bar and other interface elements. Your selection will persist whenever you log in to the controller from the same browser.

## Feature Enhancements (2.08.1140)

The following enhancements have been made to existing features in this release.

### LED Color Support

- Added support for LED colors and patterns on OSDP readers connected to the onboard reader expander.
- Added the ability to define the L1 and L2 LED colors using the corresponding reader output in the software. This is available for both ICT RS-485 and OSDP readers.

To set the LED color, add the following command to the output programming: **LEDColour = X**, where **X** corresponds to a color code from the table below.

This command can be used with the following outputs on a reader expander or controller onboard reader expander:

- Output 3 (Green LED Port 1)
- Output 4 (Red LED Port 1)
- Output 6 (Green LED Port 2)
- Output 7 (Red LED Port 2)

The following color codes are available:

Number (X)	Color	Supported Reader(s)
1	Red	ICT RS-485, OSDP
2	Amber	ICT RS-485, OSDP
3	Orange	ICT RS-485
4	Yellow	ICT RS-485
5	Lime	ICT RS-485
6	Green	ICT RS-485, OSDP
7	Mint	ICT RS-485
8	Turquoise	ICT RS-485
9	Cyan	ICT RS-485
10	Sky Blue	ICT RS-485
11	Cobalt	ICT RS-485
12	Blue	ICT RS-485, OSDP
13	Violet	ICT RS-485
14	Purple	ICT RS-485, OSDP
15	Magenta	ICT RS-485
16	Crimson	ICT RS-485

This feature is only supported on tSec Readers with RGB LEDs.

Custom LED colors may not function correctly when enhanced reader outputs are enabled and one output is activated on the reader port. This is a known issue. This operation has not yet been validated with area status display functionality, function codes, and 'LED follows lock' functionality (i.e. when the door's lock output is not the default reader port lock output) handled by the controller.

### Low Level Elevator Integration

- The controller now indicates which of the user's cards was presented when accessing an elevator.

### ThyssenKrupp HLI Integration

- Extended the ThyssenKrupp HLI integration to support up to 128 floors instead of 64.

For information on how to configure this feature, see Application Note 169: Protege GX ThyssenKrupp HLI Integration.

### Cybersecurity

- Improved web security by preventing cross-site scripting.
- Upgraded jQuery to 3.5.1 to include a security patch from jQuery.

### Door Forced Alarms

- Added the ability to delay door forced alarms, allowing the door to be in the 'open' state for a specified length of time before the audible alarm and door forced trouble input are activated.

For more information, see Application Note 304: Delaying Door Forced Alarms.

### Aperio Integration

- Added the ability to process ICT encrypted DESFire cards presented at an Aperio lock.

### Trouble Inputs

- Added the ability to set alarm and restore speeds for trouble inputs. This allows you to prevent a trouble input from triggering an alarm until it has been present in the system for a set time.

For more information, see Application Note 305: Trouble Input Alarm and Restore Speeds.

### Schindler PORT HLI Integration

- Added the ability to set a home floor for a user.
- Added support for the 'Pure Wiegand' site code format.
- Updated the process for sending users to the Schindler database, so that the user's ID is sent instead of the name.

For more information, see Application Note 196: Protege GX Schindler HLI Integration.

### Elevator HLI

- Added the ability to process the door lock output / output group (if configured) in elevator HLI integration.
- Added the ability to process ASCII card reads from the Otis elevator integration.

### Expander Module Support

- Added support for updating the firmware of the PRT-TS50 module.

## Issues Resolved (2.08.1140)

The following issues were resolved with this release.

- Resolved an issue with the Otis AEA Type B and EMS elevator integrations where timers were not reset on all the elevator cars in the elevator group, if the group had been marked as offline.
- Resolved an issue where the onboard reader expander's port 1 exit reader was not restoring beeper operations correctly after an access granted event.
- Resolved a reporting issue where, when the primary channel failed, the trouble input ReportIP Reporting Failure would not open after the message retry attempt limit was reached.
- Resolved an issue where door lockdown could be overridden by an unlock schedule if a manual unlock command was sent while the schedule was valid.
- When changing a user's PIN from the keypad, there is now a check against existing user duress PINs when the **Treat User PIN Plus 1 as Duress** option is enabled.
- Resolved an issue where changing a user's PIN from the keypad caused the controller to restart.

- Resolved an issue where a keypad's firmware could not be updated if it did not have a corresponding module record configured.
- Resolved an issue where performing a module update after a firmware update caused an error to be displayed.
- Resolved an issue where elevator floors were not relocking after the **Unlock Access Time** had expired.
- Resolved an issue where authentication files loaded to the controller could not be validated by third-party certificate authorities.
- Resolved an issue where updating a user PIN from the keypad in a large database could cause the controller to restart.
- Resolved an issue where the controller would not correctly clear the session key stored on a reader expander when its network port type was no longer configured for OSDP.
- Removed a security vulnerability where the controller would send the session key to a reader expander even if the session key had not changed.
- Resolved an issue where the **Relock on Door Close/Open** function was not working correctly when using additional lock outputs with no activation delays configured.
- Resolved an issue where cards greater than 32 bits were being incorrectly truncated when presented at Aperio locks.
- Resolved an issue where the lockdown state of a door was not restored when the controller was restarted.
- Resolved an issue where a crash could occur when a user with more than 255 access levels was denied access at a door.
- Resolved an issue with the Otis EMS integration where floors were not relocked correctly after the floor selection had timed out.
- Resolved an issue where the Otis EMS integration was not correctly processing the response frames for dispatch reporting.
- Resolved an issue that was causing incorrect REX/REN detection when the controller powered up.
- Resolved an issue with the Inovonics integration where pressing multiple buttons at the same time could cause an 'Error 036' event.
- Resolved an issue where, when Contact ID is used as a backup service to Report IP, the Contact ID service would not attempt to dial out after a power cycle.
- Resolved an issue where area status LED changes could cause the onboard reader's enhanced outputs to not reactivate correctly when the reader or controller was power cycled.
- Resolved an issue with the ThyssenKrupp HLI integration where the kiosk on floor 64 was not receiving the correct floor map updates.
- Resolved an issue with the ThyssenKrupp HLI integration where the maximum floor configured was not reloaded correctly if the integration was already running.
- Resolved an issue with the ThyssenKrupp HLI integration where the front and rear designation for landing based kiosks was not set correctly.
- Resolved an issue where area status LEDs were not controlled correctly when enhanced outputs were active.
- Resolved an issue where a card reader beeper could be deactivated by badging a card once at the exit reader or pressing a key on the keypad, without changing the status of the output in the system.

**Note:** The fix requires the following command to be entered in the programming of each reader expander: **ForceRestoreBeeper=true**. This command causes the reader expander to reactivate the output regularly until it is legitimately deactivated.

- Resolved an issue where Wiegand readers connected to reader ports 1 and 2 and processing the same door did not synchronize their LED operation correctly. This caused the port 2 reader L2 to remain on for too long after repeated card badges.
- Resolved a reader expander LED glitch which occurred when the door relocked.
- Resolved an issue where area status LED functionality was not always respecting standard reader LED output activation.
- Resolved an issue where the RS-485 module network would reboot periodically after the controller was powered up without an ethernet connection.

- Resolved an issue where a door using additional lock outputs, that were set to unlock with the same activation time and no delays, did not have its status updated correctly when relocked after a fire control unlock.
- Resolved an issue where a controller would not successfully boot up on OS version 2.0.16 with the ethernet cable connected.
- Resolved an issue with RGB readers connected to the controller's onboard reader in RS-485 configuration. When the reader temporarily lost connection while the door was unlocked, upon reconnection the green LED was incorrectly stuck in the 'on' state. This was resolved for the case where the door's lock output was the Lock 1 output on the onboard reader expander.
- Resolved an issue with OSDP reader LEDs not synchronizing correctly during standard door operation when configured with custom color codes.
- Resolved an issue with credentials longer than 48 bits being truncated incorrectly when presented at ICT RS-485 or OSDP readers on the controller's onboard reader expander.
- Resolved an issue where the **Tamper Input if Module Offline** option did not work correctly.
- Fixed a regression where HTTPS would be disabled on controller startup.
- Resolved an issue which occurred when two ports of a reader expander were both set for card and PIN operation. If a card was badged at one reader and an incorrect PIN entered at the other, access would be denied on the first reader.
- Resolved an issue where a 'Read Control Error' could be generated if two packets were received from PIN pads on the same reader port in quick succession.
- Resolved an issue where an output that was turned 'off timed' would not return to the correct state if it was off before the command was received.
- Resolved an issue where controllers running the Allegion integration could enter a restart loop.
- Resolved an issue where Wiegand reader LEDs which were pulsing were not restored to the correct state after the door was unlocked.
- Resolved an issue where the **Panel Name** in the System Settings could be edited, which caused incorrect settings data to be saved. The **Panel Name** is now read only.

## Protege GX Controller Firmware Version 2.08.1002

### New Features (2.08.1002)

The following new features have been included with this release:

#### Fast User Disable

With this firmware version and the accompanying software version (4.3.285), when a user record is disabled in the software, a 'User Disabled' command will be sent directly to the controller without waiting for a regular controller download. This will cause the controller to update the user record directly in its internal database, disabling the user's access rights almost immediately.

#### Compliance Types

With this firmware version and the accompanying software version (4.3.285), Protege GX's Credential Type functionality has been extended to include custom Compliance Types. For more information, see the software release notes.

#### Cybersecurity Enhancement

The list of ciphers advertised for use in the HTTPS negotiation process has been updated so that TLS\_ECDHE\_RSA ciphers are prioritized over TLS\_RSA ciphers.

#### Otis EMS (Elevator Management System) Integration

Protege GX now has the ability to integrate with the Otis EMS Interface.

For more information, see Application Note 298: Protege GX Otis Elevator Management System Integration.

## Ask for Defer Time

The command **AskForDeferTime = true** has been added to the Area commands. This allows users to specify the number of hours to defer area arming for, when logged into a keypad.

## Alternative REX Input

The command **AltREX = #** has been added to the door commands. This specifies the input to be used as a secondary REX input, which operates using the extended REX time instead of the standard door lock time.

## Aperio Integration: Privacy Mode

Privacy mode has now been enabled for the Aperio integration. When the inside push button is pressed on an IN100 device, Protege GX will deny user access until privacy mode has been released by a request to exit (turning the inside handle), or canceled by a user with super user rights. Events will be generated in the event log whenever privacy mode is activated or deactivated.

## Feature Enhancements (2.08.1002)

The following enhancements have been made to existing features in this release:

### Reader Expanders

- Updated OSDP functionality, including Secure Channel and OSDP reader support on Reader Expander modules.

For more information on supported features, see [Application Note 254: Configuring OSDP Readers in Protege GX](#).

### Function Codes

- Updated the Function Code feature to work with Door Types using custom Credential Types. Function Codes can now be implemented by Custom Credential + PIN or Custom Credential only.

### Commend Integration

- Updated the Commend integration to handle inputs programmed without the 'D' or 'A' prefix.
- Updated the Commend integration to handle the tamper alarm, duress button and door release messages.

### Schindler HLI Integration

- Extended the Schindler Elevator HLI to allow for additional ports to be opened for the Call and Life Reporting interfaces.
- Extended the Schindler Elevator HLI to allow the use of ICT readers for Schindler elevator access.

## Issues Resolved (2.08.1002)

The following issues have been resolved in this release.

- Fixed a bug in the KONE HLI service which would cause it to crash if the service was enabled but there was no other KONE programming.
- Fixed an issue with the count on access functionality for areas causing the controller to crash if it was supplied with two or fewer entries.
- Fixed an issue with Sunday schedule periods not working at the programmed times.
- Fixed an issue with the version number of devices populating in the Module Addressing window.
- Fixed an issue with the onboard RS-485 reader's offline Trouble Inputs being opened automatically when a module update was performed.
- Fixed an issue with credential events showing the actual PIN entered by the user.
- Fixed an issue where a 'Smart Reader raw credential' event was being incorrectly displayed instead of a Reader Expander raw credential event for Wiegand credentials on Reader Expanders.

- Fixed an issue where an area arming via user count reaching zero was not displaying the correct door reference in the relevant events.
- Fixed an issue with the Otis integration where the last eight floors (of 64) were not being processed correctly when there were basement (negative) floors present.
- Fixed an issue with Otis Authorized Floor V2 Packet not setting the 'Special Features' byte for the user correctly by default for Otis readers.
- Fixed an issue with 'entry granted' events showing when the reader port was configured as an exit.
- Fixed an issue with reader expanders incorrectly setting a door as forced open after a module update.
- Corrected an issue where configuring an input's EOL settings using commands could result in it flagging the module it is assigned to as requiring a module update after every download.
- Fixed an issue where custom credentials could not be presented out of sequence.
- Fixed an issue with the population of account number information in SIA/CID over IP poll messages.
- Fixed an issue with SIA/CID over IP encryption not working.
- Fixed an inconsistency with the Aperio integration, so that now when the inside handle is turned only a REX event is generated without an unlock command, as the physical mechanism is internally handled by Aperio.
- Fixed an issue with the Allegion AD-series integration incorrectly sending through a locking packet when an invalid format card is presented.
- Fixed an issue with the Allegion AD-Series integration not correctly locking/unlocking via manual commands for any lock after the first eight that are linked to a PIM.
- Fixed an issue with the Allegion AD series integration not resetting the left open trouble input when the door closes.
- Fixed an issue with EOL thresholds not working for reader expanders beyond module address 8.
- Fixed an issue with the Forced Open alarm not disabling the assigned output when the Forced Alarm Operating Schedule becomes invalid.
- Fixed an issue where the door lock output time was unexpectedly extended with dual credential access.
- Fixed an issue where the dual authentication output did not deactivate according to the specified timeout.
- Fixed an issue with detailed credential events not correctly displaying all credentials presented.
- Fixed an issue with REX and REN not being processed on the initial trigger following a restart of the controller.
- Improved security by removing the server name that is used when the web server generates HTTP response headers.
- Fixed an issue with generic input reporting for the Commend integration.
- Fixed an issue where tSec Reader area status LEDs were not working when enhanced smart reader outputs were enabled.
- Fixed an issue where a controller that was simply polling the status port could take longer than the software to decide that the connection has been lost.
- Fixed an issue with Door Alarms not working correctly when the Operating Schedule for Pre Alarms and Left Open Alarms are both invalid.
- Fixed an issue where firmware could not be updated on controllers.
- Resolved an issue where setting daylight savings time could cause the controller's internal clock to regularly skip an additional hour ahead.

## Protege GX Controller Firmware Version 2.08.911

### New Features (2.08.911)

#### New Look Web Interface

- New look web pages including multilingual operators.
- Ability to update firmware via web pages.

## HTTPS Support

- There is now support for HTTPS connection to the controller's web interface. This provides an improved level of security by encrypting communications between controller and web browser.
- ICT **strongly recommends** that HTTPS connection is established on all live Protege sites, especially where the controller's web interface can be accessed over the internet.
- These certification methods are available:
  - Validating and installing a third-party certificate obtained from a certificate authority.
  - Installing a self-signed certificate (recommended for testing only).

For more information on configuration and operation of this feature, please see Application Note 314: Configuring HTTPS Connection to the Protege GX Controller.

## Wiegand Formats Defined as Custom Credential Types

- Wiegand formats can now be specified using customized credentials allowing up to 32 formats to be recognized per reader port.

For more information on configuration and operation of this feature, please see the relevant Application Note available on the ICT Website ([www.ict.co](http://www.ict.co)).

## Offline Access to Input Status at Keypad

- The command **OfflineInputView = true** has been added to the Keypad commands. This will allow users to view the state of the inputs belonging to the primary area of the keypad, via the offline menu. The list of inputs available for viewing will be filtered to only include those which are not sealed.
- The command **ClosedInputsInOfflineView = true** has been added to the Keypad commands to work in conjunction with the new offline access to the input view menu described above. When enabled, all inputs associated with the keypad's primary area will be available to view in the offline menu irrespective of the input state.

## Area Status – Visual Feedback

- It is now possible to control the color of a reader LED via commands, based on the status of up to 4 system areas that the reader is monitoring. This gives users visual feedback to indicate the current status of any one of these system areas, depending on which area status has the highest priority.

**Note:** This feature requires tSec Readers with RGB LEDs.

For more information on configuration and operation of this feature, please see the relevant Application Note available on the ICT Website ([www.ict.co](http://www.ict.co)).

## Ademco Vista Integration

- It is now possible to integrate with Ademco Vista-128BP/Vista—250BP panels via commands.

For more information on configuration and operation of this feature, please see the relevant Application Note available on the ICT Website ([www.ict.co](http://www.ict.co)).

## Area counting

The command **CountOnAccess = DV,AL,AL,AL...** has been added to the Area programming which allows a data value (DV) to be incremented or decremented each time a user with one of the specified access levels (AL) enters or leaves the area. Up to four of these commands can be used per area.

## Expander Module Support

- Added Support for the 2nd Generation of Intercom modules.

## Feature Enhancements (2.08.911)

The following enhancements have been made to existing features in this release:

### Controller Network Security Enhancements

- Module Comms UDP/TCP (9450) has been disabled by default. It can be re-enabled via Controller commands:
  - **EnableModuleUDP = true**
  - **EnableModuleTCP = true**
- Touch Screen Comms UDP (9460) has been disabled by default. It can be re-enabled via Controller commands:
  - **EnableTLCDCommsUDP = true**
- Inter-Controller Comms TCP (9470) has been disabled by default. It will only be enabled if Protege GX has told the controller it is part of a controller group.
- Ping is disabled by default for the onboard Ethernet connection. It can be re-enabled via Controller Commands:
  - **EnablePing = true**

If you have any modules installed that utilize Module Comms (port 9450) or Touch Screen Comms (port 9460) over Ethernet you will need to add the above commands to the controller or these modules will not be able to communicate with the controller.

### Doors

- The command **LockOutAttempts = #** configures the number of retries allowed before the 'Too Many Attempts' trouble input is generated for the door. In the Door commands, add this line with your required value of retries in place of the # symbol.
- The command **AlwaysAllowREN = true** has been added to the Door commands which will allow Requests to Enter to be actioned, even when the door is open, similar to what is available for Requests to Exit functionality.
- Added ability to configure when Pre-Alarm, Left Open and Forced Open alarms are suppressed, such as when unlock schedules are valid, or when doors are unlocked by programmable functions, area control or calendar actions.
- The command **SlaveREX = true** has been added to the Door commands. This will allow a slave door to follow its primary door whenever Requests to Exit/Enter or manual commands are actioned on the primary, in addition to Access Granted actions.
- The command **AccessDeniedTime = #** has been added to the Door commands which will specify the duration in seconds that an output or output group will be activated for when access to the door has been denied. This must also be paired with one of the following 2 commands in order for the functionality to occur.
- **AccessDeniedOutput = #** has been added to the Door commands which will specify the output that will be activated when access to the door has been denied.
- **AccessDeniedOutputGroup = #** has been added to the Door commands which will specify the output group that will be activated when access to the door has been denied.
- Included the lock state as well as the door state in the multi state value that is returned when using the BACnet service.

### Salto SALLIS Integration

- The Salto SALLIS Integration can now support locks equipped with keypads.
- Added ability to process ICT encrypted DESFire cards presented at a SALLIS lock.

### High Level Elevator Integrations

- Up to 128 front and rear floor openings can now be supported for the KONE Elevator HLI.

### Input/Output/Door Status

- Improved efficiency of restoring statuses and events by controllers after losing connection with Protege GX for a significant amount of time.

### Elevators

- The command **EntryMode = #** has been added to the Elevator Car commands. This configures the type of authentication that must be used to gain access to the elevator car. The **#** symbol should be replaced with your required type of authentication as follows:

Card Only	0
PIN Only	1
Card and PIN	2
Card or PIN	3

### Readers

- Added the ability to trigger a duress trouble input from a reader's keypad.

### OSDP Support

- Controller reader ports now support the following functionality, conforming to a subset of the OSDP Version 2.1.5 specification:
  - Manual Commands
  - Function Codes (multi-color LED indication is not currently supported)
  - Beep on REX
  - Custom Credentials
  - LED Sync on Connection

Note: OSDP is not currently supported on reader expander reader ports.

For more information on configuration and operation of this feature, please see the relevant Application Note available on the ICT Website ([www.ict.co](http://www.ict.co)).

### Allegion Integration

- Added ability to handle AD300/301 locks for the Allegion AD-Series Integration.
- Added generation of connection status events for the Allegion AD-Series
- Added ability to handle deadbolt state changes for the Allegion AD-Series Integration.

For more information on configuration and operation of this feature, please see the relevant Application Note available on the ICT Website ([www.ict.co](http://www.ict.co)).

### Aperio Integration

- The command **HasAperioDeadbolt = true** has been added to the Door commands. This will allow users to define whether an Aperio lock is physically fitted with a deadbolt, which is used for processing the deadbolt functionality. By default, all Aperio locks are assumed to NOT be fitted with a physical deadbolt.

### Language Support

- Added language support for Czech, Dutch and German.

### KONE Elevator Integration

- Added the ability to handle the Destination 880 protocol.

## Issues Resolved (2.08.911)

The following issues have been resolved in this release.

- Fixed an issue with the controller not being able to handle more than 256 doors within a single access level.
- Fixed an issue where the on-board reader expander would not recognize PIN entries when set to Casi-Rusco format.
- Fixed an issue of incorrectly displaying duplicate areas when navigating through a keypad module's area group.
- Fixed an issue with tSec Readers operating in RS-485 mode occasionally dropping offline when readers with different firmware versions were wired in a multiplexed configuration on the Onboard Reader Expander.
- Fixed an issue in the BACNet service where setting the present value of a multi-state value would always set the value of the object with an index to zero.
- Improved the time synchronization between linked controllers when one has a time zone configured and one doesn't.
- Fixed an issue where OSDP readers would not read HID iClass reader PINs correctly.
- Fixed an issue with Pre-Alarm and Left Open events not being generated for the Allegion AD-Series Integration.
- Fixed an issue with Smart Reader Tamper, RF Loss and Low Battery events being incorrectly generated for the Allegion AD-Series Integration.
- Fixed an issue with the Low Battery and Tamper trouble input restoring incorrectly for the Allegion AD-Series Integration.
- Fixed an issue with Commend Integration not fully updated to handle Commend Input IDs starting with 'A'.
- Fixed an issue with the MODBUS door register write not working properly.
- Fixed an issue with operator triggered arm/disarm of Apartment areas not displaying the correct operator reference.
- Fixed an issue with REX/REN not working for the first time after a controller restarts, if the 'Invert REX/Invert REN' option is not enabled.
- Fixed an issue where PINs with leading zeros would not work when using dual authentication to log into a keypad.
- Fixed an issue where the BACnet service could fail to respond due to an invalid broadcast address.
- Resolved issue with Access Taken and Access Not Taken events not always displaying the correct user reference.
- Fixed issue with control of Area, Trouble Inputs and Elevator Floors via BACnet not working as intended.
- Resolved issue with user's access level expiry not being taken into consideration when checking the user's access to a door.
- Fixed issue with potential Receive Buffer overflow for BACnet service.
- Fixed a regression that stopped the Keypad Login Requires Card option from working.

## Protege GX Controller Firmware Version 2.08.0848

### New Features (2.08.0848)

The following new features have been included with this release.

#### **Resistor Values**

Added the ability to individually specify the resistor values connected to monitored Inputs and to specify more than two resistors if required.

### Issues Resolved (2.08.0848)

The following issues have been resolved in this release.

- Fixed issue with Function Codes not correctly checking the entry/exit mode of the door type when configured to be usable for both Entry and Exit directions on the door.
- Improved the module update process to eliminate any input or output glitching when an update is performed.

# Protege GX Controller Firmware Version 2.08.0843

## New Features 2.08.0843

The following new features have been included with this release.

### Additional Lock Outputs

Up to an additional 5 lock outputs or output groups can now be assigned to a door. Each additional lock output or output group can be configured with their own individual lock activation time, as well as a delay before activation time. This delay would allow the additional lock outputs to be activated in a staggered sequence. For information on configuring the additional Lock Outputs, please refer to the Protege GX Operator Reference Manual.

## Feature Enhancements 2.08.0843

The following enhancements have been made to existing features in this release:

### Doors

- Doors can now be associated with a new trouble input, Door Duress, when either a duress user's PIN or when a duress PIN code has been entered into the reader at the door. For information on configuring the Trouble Inputs, please refer to the Protege GX Operator Reference Manual.
- The command **DualCredPendingTime = #** configures the timeout for supplying credentials for authenticating a user, such as Card and PIN. In the Door commands, add this line with your required value of timeout in place of the # symbol.

### Keypads

- Improved process for bypassing inputs and trouble inputs when logged into a keypad.
- Improved process for viewing doors, inputs, trouble inputs and outputs when logged into a keypad.

### Inovonics Integration

- The Inovonics Integration can now support the Inovonics Repeater Module. For information on configuring the inputs and trouble inputs of the Inovonics Repeater Module, please refer to the Inovonics Wireless Receiver Module Installation Manual.

### Services

- Improved feedback to the monitoring station for Report IP services configured with 'Enable Offline Polling', when the 'Report IP Reporting Failure' trouble input has been generated.

### Dual Custody

- The command **CustodyPairEnforced = true** has been added to the Door Type commands which will update the antipassback status for both the Dual Custody Master and Dual Custody Provider. In addition, both the Dual Custody Master and Dual Custody Provider will be included in the area counting process.

### Access Level Outputs

- Access level outputs can now be toggled between activations.
- Access level outputs can now be activated when reader port operates under 'Area Control' mode.

## Issues Resolved 2.08.0843

The following issues have been resolved in this release:

- Resolved issue with the Log Message Retries and Log Reporting Failure options not working correctly for the Report IP service.
- Resolved issue with Modbus service unable to deactivate an input.
- Keypad no longer displaying incorrect language when accessing certain offline menus.

- Resolved issue with Defer Automatic Arming not working when deferring using a card badge.
- Activate Access Level Output now works correctly for reader port 2 when configured for Elevator Mode.
- Resolved issue with tSec Readers operating in RS-485 mode not generating the Door Too Many Attempts trouble input correctly.
- Resolved issue with tSec Readers connected to the onboard reader expander momentarily dropping offline after programming is downloaded.
- Improved efficiency of sending via backup service for Report IP when all channels have been determined as offline.
- Resolved issue with invalid PINs entered via readers reporting as raw card read events.
- Access level outputs now activate correctly as per configurations when triggered via Smart Readers.
- Corrected an issue where certain combinations of username and password supplied for CSV IP service would cause the controller to crash.

## Protege GX Controller Firmware Version 2.08.0825

### New Features (2.08.0825)

The following new features have been included with this release.

#### Card Usage Counting for Access Limits

User Cards can now be limited to a certain number of Access Granted swipes for a particular time period. This can be used to enable scenarios such as cafeteria line access or clubroom access based on membership policies. To enable this functionality, enter **LimitUsage=true** into the Access Level Commands.

- The command **UsesBeforeDisable = #** configures the number of uses for the Access Level before its disabled. In the Access Level Commands, add this line with your required value of uses in place of the # symbol.
- The command **UsageResetType = #** configures how long the Access Level usage will be Disabled for in terms of minutes (m/M), hours (h/H) or days (d/D). In the Access Level Commands, add this line with your required reset type in place of the # symbol.
- The command **UsageResetPeriod = #** configures the frequency on when the access level usage will be reset. In the Access Level Commands, add this line with your required value reset period in place of the # symbol.

#### Door Type Override in Access Levels

A new feature has been added to the system to allow a given Access Level to override the Door Type. The Doors in the Access Level will all use the Door Type specified in the Access Level, instead of the Door Type specified in the Door. This allows certain User or groups of Users to, for example only require a PIN at a door that would normally require Card and PIN.

- To enable this functionality, enter **AllowOverrideDoorType = true** into the Access Level Commands.
- The command **OverrideDoorType = #** can then be added to Door Type Commands. This specifies the Door Type to be used as the overriding Door Type.

#### Sequential Access Level Output Activation

Access Level Outputs are typically used to activate a specific feature in the building for a User or group of Users. A new feature has been added to allow multiple Access Level Output activations from a single card swipe, as long as the Access Level Start and End Expiry times create a continuous time period. This feature can be used to enable a variety of booking system scenarios where a User may request multiple bookings for all or parts of a facility in the same day.

For more information on configuration and operation of this feature, please see the relevant Application Note available on the ICT Website ([www.ict.co](http://www.ict.co)).

## Feature Enhancements (2.08.0825)

The following enhancements have been made to existing features in this release:

### Elevators

- The command **FloorAccessCheckCar = true** has been added to the Controller commands which allows Floor access to be granted based on all of the User's Access Levels, as well as the Elevator being used.

### Inovonics Integration

- The Inovonics Integration can now associate low battery states for wireless devices with Trouble Inputs, as well as generating Events. For information on configuring the Trouble Inputs, please see the Inovonics Integration Module Installation Guide.

### Access Level Outputs

- Currently active Access Level Outputs will now be turned off if the Access Level is removed from the User that activated the Output, or if the Expiry Time is updated to be outside the current time.

## Issues Resolved (2.08.0825)

The following issues have been resolved in this release:

- Fixed an issue where a Report IP service that fails over IP and switches to PSTN for back-up would not correctly open the "Report IP reporting failure" trouble input.
- Fixed an issue where users with credential programming that varied greatly in length from the credentials of other users would not always be found when their credentials were submitted. This did not affect facility/card numbers or PINs, nor credentials of similar length.
- Fixed an issue where under certain conditions, if a user badged at a door to which they did not have access the controller would restart.
- Stay Arming from a keypad is now possible when Inputs have been bypassed.
- Resolved an issue with a 'Module requires an update' being generated incorrectly for Outputs and Inputs in a Cross Controller Configuration.
- Function Codes now work correctly when the Door Type has been set to Card and PIN.
- Modules are now able to register successfully behind the Module Network Repeater after it was previously registered directly with the controller (and vice versa).
- Schedules now work correctly for those that are valid across the midnight threshold.
- Inputs 9 through to 16 now working correctly for the F/2F module after performing a module update.
- Resolved an issue where processing a numeric credential greater than half the length defined in the Credential Type would cause a Controller restart.
- Over Current Trouble Input is no longer triggered incorrectly on the Single Door Controller with PoE.
- Feedback is now provided when a User fails to gain access after validating against the Fallback Door Type.
- The Inovonics Integration Module Input States are now being set correctly after a module update for the first 8 inputs.
- Valid Credentials are no longer interpreted as Raw Credential reads under certain conditions.

Designers & manufacturers of integrated electronic access control, security and automation products.  
Designed & manufactured by Integrated Control Technology Ltd.  
Copyright © Integrated Control Technology Limited 2003-2022. All rights reserved.

**Disclaimer:** Whilst every effort has been made to ensure accuracy in the representation of this product, neither Integrated Control Technology Ltd nor its employees shall be liable under any circumstances to any party in respect of decisions or actions they may make as a result of using this information. In accordance with the ICT policy of enhanced development, design and specifications are subject to change without notice.